Ignis 150/180 TIG


Quick Guide





Safety

Before carrying out any work with the device, ensure that you have read and understood all the documents provided as well as those available online! This document does not describe all the functions of the device. For a complete description of the device, refer to the Operating Instructions.

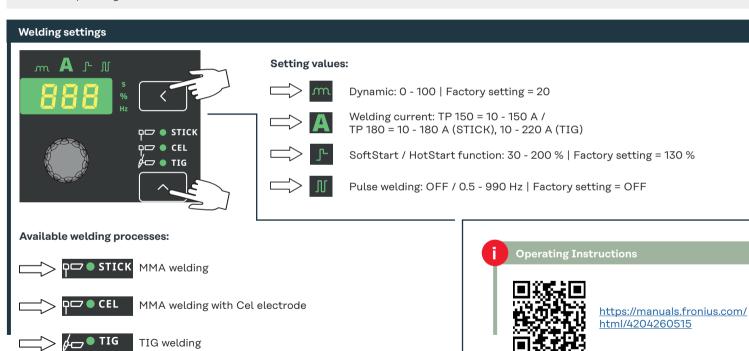



Accessing the setup menu









Setup menu MMA welding



Setup menu Cel electrodes



Setup menu TIG

Changing welding parameters



Turn and press the adjusting dial to select and change parameters.

Parameters for MMA welding

Starting current duration: 0.1 - 1.5 seconds | 0.5 seconds*

ASH Anti-stick: On* / OFF

Start ramp: On* / OFF

Break voltage: 25 - 90 V | 45 V*

Factory setting

Level 2 Setup menu

Welding parameters in the level 2 Setup menu

SOF Software version

Automatic switch-off: 5 - 60 minutes / OFF*

Fuse: 230 V = 10 A, 13 A, 16 A* / 120 V = 15 A, 16 A, 20 A*

Operating time: hours, minutes, seconds

Welding time: hours, minutes, seconds

Parameters for TIG welding

Operating mode: OFF / 2-step* / 4-step

Starting current: 1 - 200 % | 50 %*

Reduced current: 1 - 200 % | 50 %*

Final current: 1 - 100 % | 50%*

GPa Gas post-flow time: 0.2 - 25* seconds

Comfort Stop sensitivity:

TP150 = OFF / 0.6 - 3.5 V | 1.5 V* TP180 = OFF / 0.6 - 3.5 V | 1.5 V*

Break voltage: 10 - 45 V | 35 V*

Tacking function: OFF* / 0.1 - 5.0 seconds

Factory setting

Level 2 Setup menu